
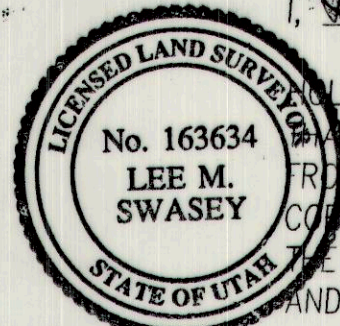


UDOT Control Point locations

Control Point	Northing	Easting	Elevation
CP - 1	9567.36510	8956.12440	1939.32
CP - 2	10000.00000	10000.00000	2000.00
CP - 3	9712.23320	9959.52000	1969.98
CP - 4	9884.12790	9561.44760	1979.05
CP - 5	8821.64830	8215.18450	1885.34

Right - of - way marker locations

ROW Cap #	Station	Offset	Northing	Easting	Elevation
Based on UDOT assumed coordinates and elevations					
ROW 1	Existing Centerline	100' Right	8930.07741	8600.18080	1887.65
ROW 2	Existing Centerline	100' Right	8994.37500	8668.24304	1886.61
ROW 3	Existing Centerline	100' Left	9203.04072	8599.30737	1893.75
ROW 4	0+00	100' Left	9302.99277	8725.41859	1888.95
ROW 5	0+00	100' Right	9140.07263	8841.42301	1936.92
ROW 6	3+50	100' Right	9343.08037	9126.53327	1939.23
ROW 7	3+50	150' Right	9302.35033	9155.53437	1913.64
ROW 8	3+93.54	100' Left	9531.25467	9045.99656	1902.48
ROW 9	4+49.68	60' Left	9531.23309	9114.92913	1914.64
ROW 10	7+44.43	110' Right	9563.71248	9453.63645	1947.08
ROW 11	7+44.43	150' Right	9531.12845	9476.83734	1965.16
ROW 12	PC 8+32.36	60' Left	9753.19595	9426.66054	1931.23
ROW 13	PC 8+32.36	110' Right	9614.71382	9525.26430	1922.74
ROW 14	PRC 11+91.78	33' Left	9922.96843	9750.91190	1972.78
ROW 15	PRC 11+91.78	68.35' Right	9833.70325	9798.90342	1937.83
ROW 16	PT 15+83.64	33' Left	10136.36007	10071.46585	2007.29
ROW 17	PT 15+83.64	33' Right	10085.09704	10113.03629	2008.87

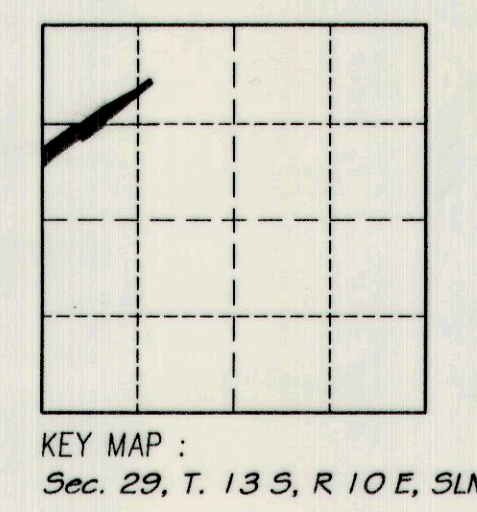

CERTIFICATE

I, Lee M. Swasey, A PROFESSIONAL LAND SURVEYOR, HOLDING UTAH CERTIFICATE NO. 163634, DO HEREBY CERTIFY THAT THE PLAT SHOWN HEREON HAS BEEN PREPARED FROM A FIELD SURVEY MADE UNDER MY DIRECTION AND CORRECTLY SHOWS THE DIMENSIONS AND MONUMENTS OF THE PROPERTY DESCRIBED TO THE BEST OF MY KNOWLEDGE AND BELIEF.

LOCATION OF SURVEY:
 Located within the Northwest quarter of Section 29, T. 13 S., R. 10 E., SLM.

BASIS OF BEARING:
 N 00°11'00" W between the West quarter corner and the Northwest corner of said Section 29.

PURPOSE OF SURVEY:
 Surveyed as part of the Utah Department of Transportation, Kenilworth Bridge Spot Improvement, Project SP - 0157 (1) 1, to locate, and set the Right-of-way monuments shown hereon. The survey was based on existing monuments and on the UDOT plans and specifications for the above mentioned project.

MONUMENTS SET:
 ● Denotes a Standard UDOT Right-of-way Marker.

MONUMENTS FOUND:
 ◆ Denotes Section monument found.
 ▲ Denotes UDOT Control monument found.

SECTION 29	TOWNSHIP 13 S.	RANGE 10 E.	DATE 19-June-98	SCALE 1" = 200'	
BLOCK 10E	PLAT 10E	SURVEY 10E	DRAWN BY L.M.S.		
SURVEY FOR Utah Department of Transportation Region 4 Richfield, Utah			OFFICE USE SURVEY # SP-0157(1)1 FILE pppro\kenilwth		